

Service Bulletin # 09-11

October 19, 2009

Questions or comments regarding this service bulletin may be directed to:

Erin Francis Phone 1-604-882-9333

BREAKER WIRE INSPECTION

☒ Mandatory ☐ Optional ☐ Information Only

☒ NewEra XC ☐ FleetMax ☐ Commander ☐ Legend 138 ☐ Legend 158 ☐ Classic ☐ Bus

Vehicles affected: 62725 through 62790

Please complete the requirements of this service bulletin within 45


Part Cost n/a Labour Allowance included with accompanying bulletins.

Details

This intention of this bulletin is to confirm the correct routing of wires #58 (Thermo Power) and #154 (Right Bank Cot Lights), each located in the ecc. There have been reported incidents of the #58 wires being attached to the incorrect circuit breaker #10 which overloaded the breaker, causing it to trip. Please ensure that the #58 Thermo Power wires are attached to the #8 circuit breaker, and the #154 Right Bank Cot Light wires are attached to the #10 circuit breaker.

A portion of the 4 hours allocated for Bulletin 09-09 BCAS Isolator Installation has been set aside for this inspection; any labour to inspect and or make adjustments will be part of and within this 4 hour allowance.

Thank you.

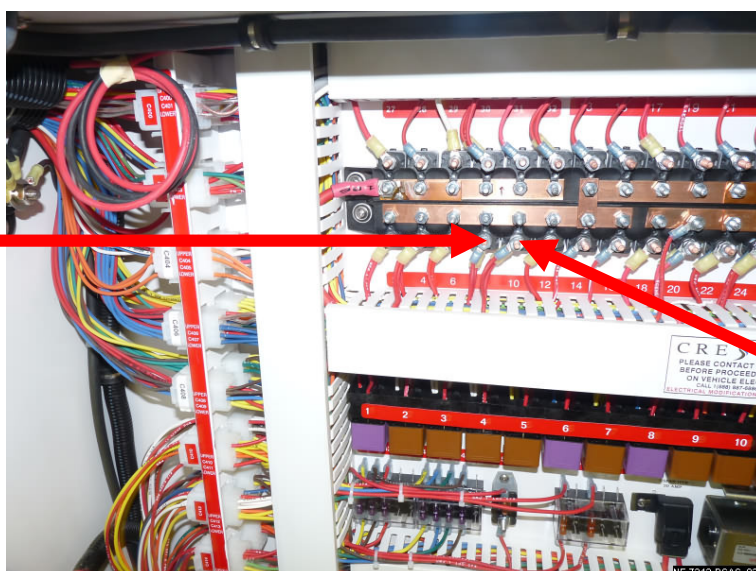

#8 breaker. Confirm #54 Thermo Power wires are attached here.

#10 breaker. Confirm #154 Right Cot Light wires are attached here.

Fig 1 View of circuit breakers