

INTERSECTION LIGHTS SERVICE BULLETIN

UP 124A REV 1 2016-02-25 Page 1 of 1

AMBULANCE TYPE: MX151D Units: 62911 to 62979

ISSUE

This bulletin is to inform owners of Demers Ambulances (unit numbers listed above) that a modification of wiring harness is required. Front fender intersection lights are activated with the left/right flasher and with emergency lights. Modification will consist of removing left/right flasher feature but emergency lights will continue to flash.

ACTION

Modification of the wiring is required during the next scheduled 'A' service safety inspection. Please perform the modification as per the attach documentation.

SERVICE PROCEDURE


Modification time: 0.15 hour / per vehicle.

Please note:

With our new paperless warranty system no form is required to be filled out as these recalls are <u>pre-approved</u> for the time allotted, please fax your invoice to Demers Customer Assistance Centre service department at: 1-306-373-4144.

*Please be sure to indicate the service bulletin number on the invoice.

Should you require additional time or have questions please call our Demers Customer Service Centre toll free at **1-855-373-9789**.

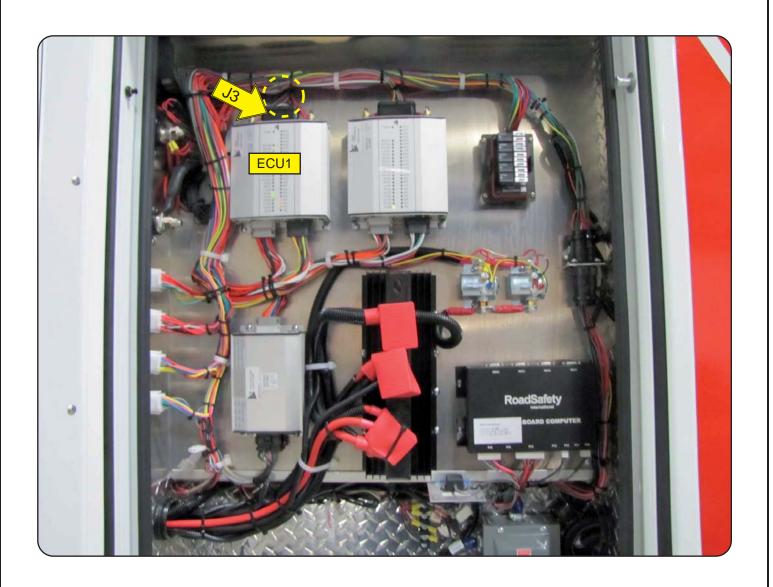

This modification is for unit number 62911 to 62979

- 1 Locate connector <u>J3</u> on <u>module ECU-1</u>.
- 2 Remove connector J3 and locate pin 7 left flasher / pin 8 right flasher (see diagrams on page 2)
- 3 <u>Cut</u> and <u>insulate</u> wires at both ends on <u>pins 7 & 8</u> (yellow & green wires).
- 4 Reinstall connector <u>J3</u> and <u>make sure left and right flashers work</u> on side and rear of the ambulance module.

THE INFORMATION, TECHNICAL DATA AND STANDARDS DESCRIBED HEREIN ARE THE EXCLUSIVE PROPERTY OF DEMERS AMBULANCES AND/OR CONTAIN PROPRIETARY RIGHTS OF OTHERS AND ARE NOT TO BE USED OR DISCLOSED TO OTHERS WITHOUT THE WRITTEN AGREEMENT OF DEMERS AMBULANCES.



TITLE :

INTERSECTION LIGHT « STEADY-BURN » DEACTIVATION FEATURE (UNIT 62911 TO 62979)

	DRAW. :	# DRAWING :	REV :	
2016-04-13	V BUBÉ	# 00994		1
# ASS :	Y. DUBE	# 00994	PAGE :	1/2

